PMD85: Outdoor Digital Dual-Optic High-Performance PIR V2.5 P A R D











Description

The PMD85 Outdoor Digital Dual-Optic High-Performance PIR overcomes the environmental challenges of the outdoors while giving you the same reliability as a highperformance indoor motion detector by combining a special weatherproof design with the proven technology of Paradox's patented digital detection.



The PMD85 also features patented animal immunity, which by way of two sensors, allows the unit to identify humans while ignoring animals weighing up to 40kg (90lbs.).

Installation

There are three different mounting methods that can be used for the PMD85, they include corner-mount, flat surface mount, or swivel-mount using the SB85. When installing the PMD85, avoid placing the detector within proximity of sources of interference such as direct sunlight, reflective surfaces and moving cars. To install the PMD85:

- 1) Select the detector's location.
- 2) Remove the front cover screws holding the cover into place; open the cover.
- 3) Loosen the screw holding the PCB into place and gently slide and lift from back cover.
- 4) Drill or punch out the selected knockout holes from the PMD85 back cover as shown in Figure 1 and secure to surface using appropriate mounting screws.

Note: The PMD85 can also be mounted using the Paradox Heavy Duty Swivel Mount Bracket (SB85). The swivel mount may allow for easier mounting. If using the swivel mount, it is recommended that you seal the space where the swivel mount is connected to the back cover with some silicon or with a rubber gasket to ensure that moisture does not enter the detector. After you have installed the detector, ensure that the adjustable height markings on the upper right of the PCB's cover inside the unit match the installation height (see Figure 2). Any PCB adjustments should be followed by a walk-test to verify detector coverage.

WARNING: 1. Do not touch the sensor surface as this could result in a detector malfunction. If necessary, clean the sensor surface using a soft cloth with pure alcohol. 2. Avoid bending, cutting or altering the antenna as this may affect signal transmission. 3. Ensure that the unit's front and back cover are tightly joined together without any spacing (around the rim of the unit) before tightening the screw, otherwise the weatherproof casing may be compromised and moisture may enter the unit.

Features

- Impact and temperature resistant casing (lined with an injected rubber gasket)
- UV protected lens
- **Dual Optical Filtering System**
- Multi-level sensitivity adjustment
- Patented Digital Motion Detection
- Digital Dual Opposed Detection
- Alive software (alarm LED continues to display when PIR is in energy save mode without compromising battery life)
- 3-minute Energy Save mode after two detections within a five-minute period

Figure 1: Installation


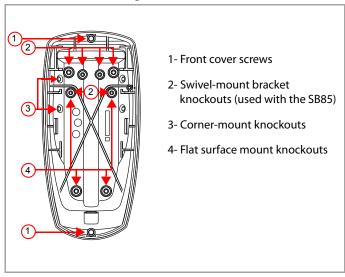


Figure 2: PCB Setup

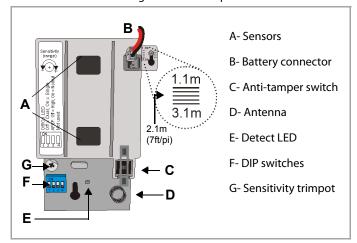

Turning on the PMD85

- 1) Insert three "AA" batteries into the battery holder while verifying polarity (see Figure 3).
- 2) Insert the battery holder into the back cover and affix the battery cable to the battery connector on the PCB. See below for a description of the PMD85's startup sequence.

Startup Sequence

After connecting the battery cable, a power-up sequence will begin. During this time, the detector will not detect an open zone or tamper. The startup sequence is as follows:


- 1) The LED flashes four times.
- 2) The LED flashes fast to indicate RF communication.
- 3) If cover is open: LED flashes to indicate trimpot sensitivity level e.g., if unit is set at default level 3, the LED flashes three times (see Figure 2, **G**- Sensitivity Trimpot). The LED will continue to indicate the sensitivity level for two minutes.

If cover is closed: End of startup sequence. The unit is ready for operation.

Replacing the Batteries

- 1) Disconnect the battery cable from the battery connector of
- 2) Remove the battery holder from the back cover and remove the old batteries.
- 3) Press and release the tamper switch to ensure that the unit has powered down.
- 4) Follow the steps outlined in "Turning on the PMD85 "above.

Figure 3: Battery Holder

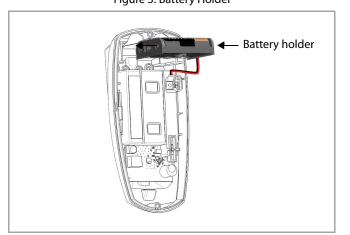

RF Signal Strength Test

In order to verify the receiver's reception of the motion detector's signal, perform a signal strength test before finalizing the installation of the PMD85. Prior to performing the test, make sure that the batteries have been inserted into the battery holder to power the detector. Also verify that the motion detector has been assigned to a zone. For more information on signal strength tests and zone programming, refer to the appropriate security panel / wireless receiver's Reference & Installation Manual. If the transmission is weak, just moving the detector by a few inches can greatly improve the reception. If the signal is still weak, it is recommended that the detector be moved to another location.

Walk-testing

To put the detector into Walk-test Mode, open and close the cover. At 20°C (68°F), with the detector at the highest sensitivity setting, in Single Edge Processing mode, and with APSP set to Normal you should not be able to cross more than one complete zone (consisting of 2 beams, left and right sensor detecting elements) in the coverage area of up to 35 feet, with any kind of movement; slow/fast walking or running.

You can adjust the sensitivity level using the trimpot. Five trimpot gain levels provide fine gain tuning with steps of 10%. The level can be adjusted between a minimum gain of 50% and maximum gain of 100%. The approximate width of a full beam at 11m (35ft) from the detector is 1.8m (6ft).

Note: 1. When walk-testing, always move across the detection path, not toward the detector. 2. After a power up, the detector will automatically enter Walk-Test mode for three minutes.

Alive Software

If the motion detector transmits two alarm signals (LED on for two seconds) within a five minute period, the detector will fall into Energy Save mode where the detector will not transmit any alarm signals for approximately 3 minutes. Due to the motion detector's Alive software, the red LED continues to flash to indicate a detection even when in Energy Save mode. Once the three-minute Energy Save mode ends, the detector will return to normal operation.

Note: If the detector's cover is removed and then replaced again, energy save mode is cancelled and walk test mode is started.

Detector Settings


Step	DIP	Details			
1 LED Setting		LED Feedback On for 2 seconds: Motion has been detected Flash every 8 seconds: Low battery trouble (checked every 12 hours)			
	DIP Switch 1				
2 Edge Processing Mode*		Single edge processing should be used in normal environments with minimal sources of interference. Dual Edge Processing requires balanced detection from both sensor elements and requires that a beam must be fully crossed even at close range. This setting provides better false alarm rejection and is suitable to all lens types, including curtain lenses. Use this setting if the detector is placed near sources of interference that can adversely affect it.			
	DIP Switch 2	$ \begin{array}{ll} OFF &= Dualedge \\ ON &= Singleedge\Delta \end{array} $			
3 Auto Pulse Signal Processing Level*		APSP measures the energy from each detected signal and stores it in memory. To generate an alarm, the memory must reach a required minimum level. APSP can be set to <i>normal level</i> or <i>high level</i> . When APSP is set to <i>normal level</i> , the unit is calibrated to detect the energy level which is typical to crossing one full single beam at the maximum detection distance. When APSP is set to <i>high level</i> , the unit is calibrated to detect the energy level which is typical to crossing two full beams at the maximum detection distance. When APSP is set to <i>high level</i> , the detector is set for high-risk environments (potential interference) and therefore provides greatly increased false alarm immunity.			
	DIP Switch 3	OFF = APSP - High level ON = APSP - Normal level Δ			
4 Trimpot Sensitivity		The PMD85 features adjustable sensitivity. Adjust from 1 (lowest sensitivity = 50%) to 5 (highest sensitivity = 100%); default = 3Δ WARNING : Depending on the sensitivity setting, an alarm condition can be generated between 0.25 sec. (highest) and 2 sec. (lowest) after the actual movement. Viewing Sensitivity Settings: Remove the cover to view how many times the LED flashes, then adjust the setting accordingly. The LED flashes a consecutive amount of times to show the setting. Thus if the sensitivity is set to 3, the LED flashes 3 times.			
	Trimpot	Turn clockwise = Increase sensitivity Turn counterclockwise = Decrease sensitivity WARNING: The sensitivity trimpot is fragile. Do not overtorque. △= default settings Note: DIP switch 4 is reserved for future use. * The response for a single beam pattern, such as the Vertical Curtain lens, may be slow at the maximum range, in such cases it is recommended that the unit be set to a single edge and/or normal APSP setting.			

Beam Patterns


The PMD85 series features the following beam patterns:

Detector	Beam Pattern
PMD85	Pet Array beam pattern
PMD85L1	Horizontal Curtain beam pattern
PMD85L2	Vertical Curtain beam pattern


Pet Array Beam Pattern

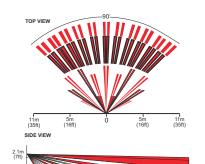

Horizontal Curtain Beam Pattern

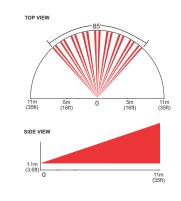

Vertical Curtain Beam Pattern

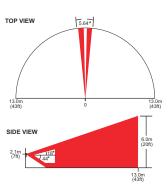

Changing the PMD85 Lens

To change the PMD85 lens:

- 1) Remove the top and bottom screws from the PMD85 front cover; remove the cover.
- 2) From the inside cover, remove the top and bottom screws holding the bezel into place.
- 3) Push and lift the locking tabs on both sides using a small screw driver. Gently lift the bezel out. Push the lens out and replace with new lens.
- 4) Align the tabs of the lens to the rubber gasket and secure into place. Ensure that there are no gaps between the lens and the rubber gasket that would allow water to leak into the PMD85. Once the lens is replaced, reconnect the bezel and secure with screws.

Technical Specifications (Detector)

Compatibility	MG5000, MG5050, MG6250, MG6130, MG6160, 1759MG, RTX3, RCV3, RX1			
Sensor type	Dual Element Infrared (x2)			
Operating temperature	-35°C to +50°C (-31°F to +122°F) Rectangular			
Sensor geometry				
Power	3 x "AA" alkaline batteries			
RF frequency	433* or 868**MHz			
Lens	2nd generation Fresnel lens, LODIFF®, segments			
Transmitter range (typical in a residential environment)	35m (115ft) with MG6160 / MG6130 / MG6250 70m (230ft) with MG5000 / MG5500 / RTX3 / RX1			
Voltage	4.5Vdc			
Tamper switch	Yes			
Detection speed†	0.2m to 3.5m/s (0.6ft to 11.5ft/s)			
Battery life‡	3 years			
* ECC ID: KDYMGPMD85 Canada: 2438A-MGPMD85				

FCC ID: KDYMGPMD85 Canada: 2438A-MGPMD85
The PMD85 compiles with part 15 of the FCC rules. Operation is subject to the following two conditions: (1) This device may not cause harmful interference, and (2) This device must accept any interference received, including interference that may cause undesired operation 868MHz (only) is not UL approved.

Tiested at 92°C. Battery life expectancy will vary according to the amount of traffic (movement) the detector has processed and the temperature outdoors. A higher check-in time interval and higher traffic will lower battery life. In colder temperatures, the capacity of alkaline batteries is reduced.

Technical Specifications (Lenses)

		Angle	Coverage	Installation	Pet
				Height	Immunity
	PMD85	90°	11m x 11m	2.1m	40kg
			(35ft x 35ft)	(7ft)	(90lbs)
	PMD85L1	85°	11m x 11m	1.1m	Multi/
	(Horizontal)		(35ft x 35ft)	(3.6ft)	large pet
	PMD85L2	5.64°	13m (43ft)	2.1m	N/A
	(Vertical)		x 2 beams	(7ft)	

Patents: One or more of the following US patents may apply: 7046142, 6215399, 6111256, 6104319, 5920259, 5886632, 5721542, 5287111, and RE39406 and other pending patents may apply. Canadian and international patents may also apply.

Trademarks: Paradox is a trademark of Paradox Security Systems Ltd. or its affiliates in Canada, the United States and/or other countries.

Certification: For the latest information on products approvals, such as UL and CE, please visit www.paradox.com.

Warranty: For complete warranty information on this product please refer to the Limited Warranty Statement found on the website www.paradox.com/terms. Your use of the Paradox product signifies your acceptance of all warranty terms

© 2012 Paradox Ltd. All rights reserved. Specifications may change without prior

The UL approved detection speed is 0.76m/s (2.5ft/s).